

# Television and Radio Service Bulletin

GENERAL MERCHANDISE OFFICE

Insert NOW in  
Radio Service Manual  
as: Data Sheet No. ....

KITCHENER

September 23, 1958

VIKING PMP 331

On some of the above units, the plastic pins supporting the pick-up arm springs were found to be broken in transit.

These units may be easily repaired by adding a wire hook from the end of the spring to one of the diagonal cross members in the pick-up arm. A paper clip cut in half with a hook formed on each end will serve the purpose.

The hook should be placed in the proper cross member to give 8 - 9 grams pick-up weight.

Yours very truly  
Dominion ELECTROHOME Industries Limited



D. Kehn  
Service Manager

ds

