

# Television and Radio Service Bulletin

GENERAL MERCHANDISE OFFICE

Insert NOW in  
Radio Service Manual  
as: Data Sheet No. ....


KITCHENER

May 11, 1960

## MODEL PMP 423 IN HIGH LINE AREAS

When the above model is operated for several hours at high line voltages (125 - 130 volts) the 25L6GT tube may become gassy with resultant failure of the selenium rectifier.

This condition may be corrected by adding a 33 ohm 10 watt resistor in series with the motor and tube heater as noted in the sketch below.

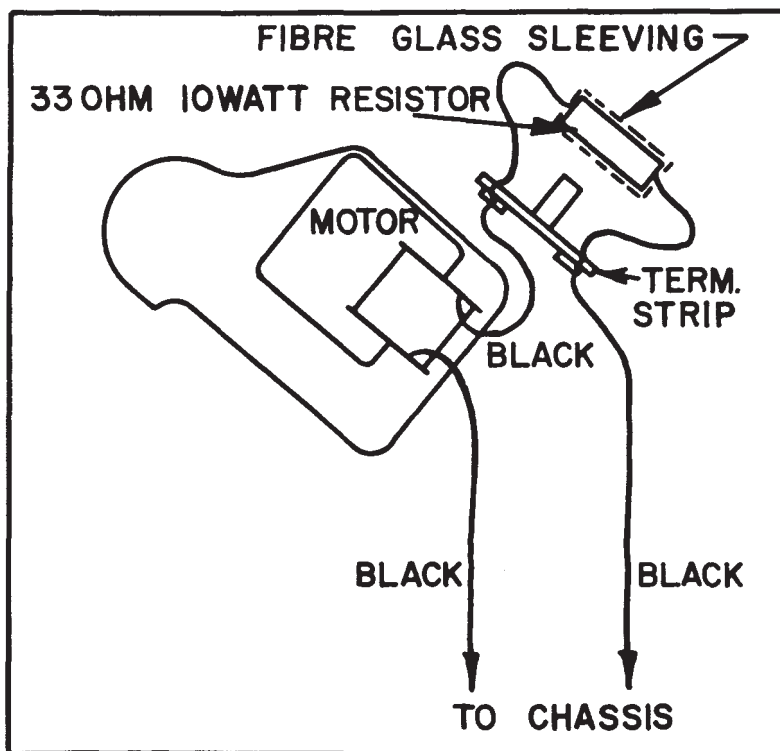

Although this problem only occurs under severe operating conditions, we are reworking present warehouse stocks to further ensure reliable operation under these conditions.

If you should encounter this problem in your area, we would recommend the above modification. Resistors are available free of charge upon request. Please refer to this bulletin when requesting resistors.

Yours very truly,

Dominion ELECTROHOME Industries Limited

D. Kehn  
Supervisor, Field Service